SHUTTLE CRITICAL ITEMS LIST - ORBITER

SUBSYSTEM : EPD&C - OMS

FMEA NO 05-6L -2259 -1

REV:10/30/87

ASSEMBLY :AFT MCA 1,2,3 P/N RI :JANTXV1N4246

CRIT. FUNC: 1R CRIT. HDW:

P/N VENDOR:

VEHICLE 102 103 104

QUANTITY :16

EFFECTIVITY: X х PHASE(S): PL X LO X OO X DO X LS X

:SIXTEEN : (TWO PER VALVE)

APPROVED BY: REDUNDANCY SCREEN: A-PASS B-FAIL C-PASS PREPARED BY: APPROVED BY (NASA): DES

D SOVEREIGN REL F DEFENSOR QĒ J COURSEN

MILL COM 11-11-17 REL ACTIVE REL QĒ

down Thorney lan SSM ERRESSM CARRENDON for Westing

ITEM:

DIODE, BLOCKING (1AMP), OMS LEFT AND RIGHT, FUEL AND OXIDIZER CROSSFEEL ISOLATION VALVE A AND B RELAY "CLOSE" INHIBIT CONTROL CIRCUITS. ("CLOSE" LIMIT SWITCH INHIBIT DIODE).

FUNCTION:

PROVIDES INHIBIT INPUT FROM THE "CLOSE" LIMIT SWITCH TO THE "CLOSE" HYBRID RELAY AND PROVIDES BLOCKING FROM THE "OPEN" MANUAL SWITCH TO THE "CLOSE" LIMIT SWITCH FOR THE CONTROL OF THREE PHASE AC MOTOR THAT ACTUATES THE OMS LEFT AND RIGHT FUEL AND CROSSFEED ISOLATION VALVE A AND FOR OV-102; VALVE A; RIGHT - 56V76A116A2CR2, 39, 66, 91. LEFT-54V76A115A1CR6, 42, 99, 100. VALVE B; RIGHT - 55V76A115A2CR2, 5, 6, 36. LEFT - 55V76A115A1CR31, 32, 33, 34. FOR OV-103 AND SUBSEQUENT; VALVE A: RIGHT - 56V76A116A2CR6, 7, 69, 76. LEFT - 54V76A114A1CR45, 73, 113, 114. VALVE B; RIGHT - 55V76A115A1CR46, 66, 75, 76. LEFT - 55V76A115A1CR6, 7, 8, 9.

FAILURE MODE:

OPENS, PAILS TO CONDUCT, HIGH RESISTANCE. (COCKPIT SWITCH IN THE "CLOSE" POSITION.)

CAUSE(S):

CONTAMINATION, THERMAL STRESS, MECHANICAL SHOCK, VIBRATION.

EFFECT(S) ON:

(A) SUBSYSTEM (B) INTERFACES (C) MISSION (D) CREW/VEHICLE (E) FUNCTIONAL CRITICALITY

(A) FIRST FAILURE HAS NO EFFECT.

FIRST FAILURE HAS NO EFFECT. ASSOCIATED AC MOTOR VALVE DRIVE "CLOSE" CIRCUIT REQUIRES CLOSURE OF TWO SETS OF RELAY CONTACTS IN SERIES BEFORE THE DRIVE IS ENERGIZED. A SECOND SIMILAR FAILURE WOULD CONTINUOUSLY ENERGIZE THE ASSOCIATED "CLOSE" CIRCUIT VALVE DRIVE. THERMAL SWITCH IN VALVE WILL INTERRUPT POWER ON A CYCLIC BASIS.

SHUTTLE CRITICAL ITEMS LIST - ORBITER

SUBSYSTEM : EPD&C - OMS

FMEA NO 05-6L -2259 -1 REV: 10/30/87

- (C.D) NO EFFECT FIRST FAILURE.
- (E) POSSIBLE LOSS OF CREW/VEHICLE DUE TO CONTINUOUS MOTOR OPERATION IN CONJUNCTION WITH A BELLOWS LEAK LEADING TO VALVE RUPTURE AND PROPELLANT RELEASE. DECOMPOSITION AND POTENTIAL FOR IGNITION EXISTS. REQUIRES TWO OTHER FAILURES (INHIBIT DIODE OF THE SERIES RELAY FAILS OPEN, BELLOWS LEAK) BEFORE THE EFFECT IS MANIFESTED. FAILURE IS NOT READILY DETECTABLE IN FLIGHT DUE TO LACK OF MONITORING MEASUREMENTS. BELLOWS LEAK NOT DETECTABLE IN FLIGHT.

DISPOSITION & RATIONALE:

- (A) DESIGN (B) TEST (C) INSPECTION (D) FAILURE HISTORY (E) OPERATIONAL USE
- (A-D) FOR DISPOSITION AND RATIONALE REFER TO APPENDIX F, ITEM NO. 3 DIODE.
- (8) GROUND TURNAROUND TEST
 V43CAO.070 REDUNDANT CIRCUIT VERIFICATION (PERIODIC) ORB/POD;
 PERFORMED FOR FIRST FLIGHT AND AT FIVE FLIGHT INTERVALS OR FOR LRU
 RETEST PER FIGURE V43Z00.000 OR FOR ORBITER DISRUPTED COPPER PATHS.
 FUNCTIONAL CHECKOUT OF AC MOTOR VALVE CONTROL CIRCUITS PER FIGURE
 V43CAO.070-2.
- V43CAO.072 REDUNDANT CIRCUIT VERIFICATION: PERFORMED EACH FLIGHT (AFTER FIRST FLIGHT). FUNCTIONAL CHECKOUT OF AC MOTOR VALVE CONTROL CIRCUITS PER FIGURE V43CAO.070-2.
- V43CBO.165 AC MOTOR VALVE ACTUATOR SNIFF CHECK; PERFORMED EACH FLIGHT. ALL AC MOTOR VALVE ACTUATORS CHECKED FOR PRESENCE OF PROPELLANT VAPORS.
- (E) OPERATIONAL USE
 REMOVE FOWER FROM RELAY BY PLACING MANUAL SWITCH IN GENERAL PURPOSE
 COMPUTER (GPC) POSITION.