PAGE: 1

PRINT DATE: 10/18/94

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL HARDWARE

NUMBER: 02-5E-MK02-X

SUBSYSTEM NAME: P/L RETENTION & DEPLOY - LATCHES

REVISION:

10/18/94

PART NAME VENDOR NAME

**PART NUMBER VENDOR NUMBER** 

ASSEMBLY : MIDDLEWEIGHT KEEL LATCH

V073-544430

LRU

: MOTOR/BRAKE ASSEMBLY

MC287-0054-0001

LRU

: MOTOR/BRAKE ASSEMBLY

2960614-021 MC287-0054-0002

2960614-021

# PART DATA

# EXTENDED DESCRIPTION OF PART UNDER ANALYSIS: MOTOR/BRAKE ASSEMBLY .

**QUANTITY OF LIKE ITEMS: 10** 2 PER LATCH ASSEMBLY 10 MAX PER VEHICLE

#### FUNCTION:

MIDDLEWEIGHT KEEL LATCH REACTS FLIGHT LOADS ON PAYLOAD VERTICAL TRUNNION HELD BETWEEN TWO SPHERICAL HALF BEARINGS. REDUNDANT MOTORS ACT THROUGH A DIFFERENTIAL AND GEARBOX TO DRIVE THE LINKAGES, BALLSCREW AND SECONDARY FRAME. THE MOTORS INCORPORATE INTEGRAL BRAKE MECHANISMS AND ARE CONTROLLED BY POSITION SWITCHES LOCATED WITHIN THE LATCH. TWO A/C PHASES ARE REQUIRED TO LIFT THE BRAKE AND POWER THE MOTOR. THERE ARE NO SINGLE FAILURE MODES WHICH WOULD ALLOW A FREE WHEELING MOTOR AFTER APPLICATION OF POWER,

PAGE: 1

PRINT DATE: 10/18/94

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL FAILURE MODE NUMBER: 02-5E-MK02-01

REVISION#

3

10/16/94

SUBSYSTEM NAME: P/L RETENTION & DEPLOY - LATCHES

LRU: MIDDLEWEIGHT KEEL LATCH
ITEM NAME: MOTOR/BRAKE ASSEMBLY

CRITICALITY OF THIS

FAILURE MODE: 1R2

FAILURE MODE: LOSS OF OUTPUT

MISSION PHASE:

00

ON-ORBIT

**DE-ORBIT** 

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS

105 ENDEAVOUR

CAUSE:

CONTAMINATION/FOREIGN OBJECT/DEBRIS, DEFECTIVE PART/MATERIAL OR MANUFACTURING DEFECT, ELECTRICAL FAILURE - OPEN, SHORT, ETC., FAILURE/DEFLECTION OF INTERNAL PART, BRAKE FAILS TO DISENGAGE.

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) PASS

C) PASS

PASS/FAIL RATIONALE:

A)

B)

C)

#### - FAILURE EFFECTS -

## (A) SUBSYSTEM:

FIRST FAILURE - LATCH OPERATES AT SINGLE MOTOR SPEED. SECOND FAILURE - LOSS OF CAPABILITY TO OPERATE LATCH.

## (B) INTERFACING SUBSYSTEM(S):

SÉCOND FAILURE WILL RESULT IN LOSS OF ABILITY TO DRIVE LATCH OPEN OR CLOSE.

#### (C) MISSION:

SÉCOND FAILURE WILL RESULT IN A POSSIBLE LOSS OF MISSION DUE TO INABILITY TO RELEASE OR RESTRAIN PAYLOAD.

PAGE: 2 PRINT DATE: 10/18/94

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL FAILURE MODE NUMBER: 02-5E-MK02- 01

# (D) CREW, VEHICLE, AND ELEMENT(S):

SECOND FAILURE WILL RESULT IN POSSIBLE LOSS OF CREW/VEHICLE DURING ENTRY DUE TO UNRESTRAINED PAYLOAD.

# (E) FUNCTIONAL CRITICALITY EFFECTS: NONE

#### -DISPOSITION RATIONALE-

#### (A) DESIGN:

THE KEEL FRAME, GEARBOX, AND HOUSING ARE FABRICATED OF TITANIUM. THE MOTOR HAS THE DESIGN REQUIREMENTS OF THREE PHASE, 400 HZ, AC INDUCTION MOTOR AND INTEGRAL BRAKE THAT WILL BE USED IN A SPACE ENVIRONMENT. THE MOTOR IS ENCLOSED WITH COVER TO EXCLUDE CONTAMINATION. IT HAS FACTOR OF SAFETY OF 1.4 OVER LIMIT LOAD. MATERIAL AND PROCESS FOR THE MOTOR ARE IN ACCORDANCE WITH MC999-0096. THIS MOTOR IS SAME AS USED ON ALL PAYLOAD RETENTION LATCHES.

#### (B) TEST:

ACCEPTANCE TESTS: THE FOLLOWING TESTS ARE PERFORMED FOR ALL FLIGHT ARTICLES AND WERE PERFORMED FOR EACH QUALIFICATION TEST ARTICLE: VIBRATION - RANGE 20 TO 2,000 HZ MAXIMUM LEVEL OF 0.04 G2/HZ FROM 80 TO 350 HZ, ALL AXES. THERMAL STABILIZED RANGE FROM -180 DEG F TO +255 DEG F. FUNCTIONAL TESTS CONDUCTED AT -80 DEG F, AMBIENT AND +255 DEG F. LOADS/ALIGNMENT - VERIFY RETENTION OF LATCHED POSITION AT 80% LIMIT LOAD, AS WELL AS SPHERICAL BEARING TORQUE RESISTANCE AND TRAVEL LIMITS. ELECTRICAL - VERIFY (WITHIN DESIGN LIMITS) CONTINUITY, DIELECTRIC STRENGTH, INSULATION RESISTANCE, AND SWITCH OPERATION.

QUALIFICATION TESTS: QUALIFICATION IS BY SIMILARITY TO LIGHTWEIGHT KEEL LATCH (V073-544300).

OMRSD: ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

#### (C) INSPECTION:

RECEIVING INSPECTION

MATERIAL AND PROCESS CERTIFICATIONS VERIFIED BY INSPECTION. INSPECTION VERIFIES THAT A SAMPLE FROM EACH LOT OF MATERIAL IS SPECTROSCOPICALLY ANALYZED TO VERIFY MATERIAL CHEMISTRY.

#### CONTAMINATION CONTROL

ALL PARTS ARE CLEANED BEFORE ENTERING STOCK ROOM AND RECLEANED BEFORE ENTERING CLEAN ROOM, VERIFIED BY INSPECTION. INSPECTION VERIFIES THAT PARTS ARE CLEANED TO LEVEL "VISIBLY CLEAN" OF MAO1 10-311 PRIOR TO ASSEMBLY. MOTOR/BRAKE ASSEMBLY IS ASSEMBLED IN A CLASS 10,000 CLEAN ROOM, VERIFIED BY INSPECTION.

ASSEMBLY/INSTALLATION ALL PARTS ARE DIMENSIONALLY INSPECTED, VERIFIED BY INSPECTION. ASSEMBLY OPERATIONS ARE VERIFIED BY INSPECTION. RTV

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL FAILURE MODE NUMBER: 02-5E-MK02-01

APPLICATION TO KEEP MOISTURE OUT OF THE MOTOR IS VERIFIED BY INSPECTION.

# **CRITICAL PROCESSES**

HEAT TREATING AND SOLDERING IS VERIFIED BY INSPECTION. PASSIVATION OF STAINLESS STEEL PARTS IS VERIFIED BY INSPECTION. EXAMINATION OF SOLDER JOINTS BEFORE THEY ARE CLOSED UP AND SEALED IN WINDINGS IS A MANDATORY INSPECTION POINT. HEAT TREATING OF SHAFTS IS VERIFIED BY HARDNESS TEST.

#### TESTING

ATP (INCLUDING TESTING AT EXTREME TEMPERATURES, AT VARIOUS LOADS AND AT VARIOUS POSITIONS) IS VERIFIED PER PROCEDURE. WINDING RESISTANCE TEST IS VERIFIED BY INSPECTION. HIGH POTENTIAL TEST IS VERIFIED BY INSPECTION.

# HANDLING/PACKAGING

HANDLING AND PACKAGING REQUIREMENTS ARE VERIFIED BY INSPECTION.

# (D) FAILURE HISTORY:

FAILURE HISTORY IS TRACKED IN THE PRACA SYSTEM.

## (E) OPERATIONAL USE:

IF THE LATCH FAILS IN THE CLOSED POSITION, UNBERTH, DEPLOY, AND/OR JETTISON OF THE ASSOCIATED PAYLOAD MAY BE ATTEMPTED USING RMS OPERATIONS, BACKAWAY MANUEVERS, AND/OR EVA PROCEDURES TO PRECLUDE RETURN OF AN UNSECURED PAYLOAD.

- APPROVALS -

EDITORIALLY APPROVED

: RI

EDITORIALLY APPROVED

:JSC

TECHNICAL APPROVAL

: VIA CR

SENTANA

PRINT DATE: 10/18/94