

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL HARDWARE**NUMBER:03-1-0218 -X****SUBSYSTEM NAME:** MAIN PROPULSION**REVISION:** 2 08/07/00**PART DATA**

	PART NAME	PART NUMBER
	VENDOR NAME	VENDOR NUMBER
LRU	:HIGH PRESSURE THREE WAY SOLENOID VALVE, NC TYPE 1 UNITED SPACE ALLIANCE - NSLD	MC284-0404-0041, -0051 13110-5, -6

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

VALVE, SOLENOID, NORMALLY CLOSED 3-WAY 3/8 INCH. LH2 FEED DISCONNECT CONTROL. CLOSING SOLENOID.

VALVE WAS ORIGINALLY DESIGNED AND MANUFACTURED BY WRIGHT COMPONENTS (NOW PERKIN ELMER) BUT IS NOW MANUFACTURED BY UNITED SPACE ALLIANCE-NSLD AS AN ALTERNATE PRODUCTION AGENCY.

REFERENCE DESIGNATORS: LV49**QUANTITY OF LIKE ITEMS:** 1**FUNCTION:**

CONTROLS PNEUMATIC PRESSURE TO CLOSE THE 17" LH2 FEED DISCONNECT (PD2). THE SOLENOID MUST DEACTUATE TO ALLOW THE DISCONNECT ACTUATOR TO VENT WHEN THE DISCONNECT IS OPENED. OPENING SOLENOID (LV48) (REFERENCE FMEA/ CIL 03-1-0217) MUST DEACTUATE TO ALLOW VALVE TO CLOSE.

FAILURE MODES EFFECTS ANALYSIS FMEA -- CIL FAILURE MODE**NUMBER: 03-1-0218-04****REVISION#:** 2 08/07/00**SUBSYSTEM NAME:** MAIN PROPULSION**LRU:** LH2 17" DISCONNECT CLOSE SOLENOID (LV49)**CRITICALITY OF THIS****ITEM NAME:** LH2 17" DISCONNECT CLOSE SOLENOID (LV49)**FAILURE MODE:** 1R2**FAILURE MODE:**

PREMATURE ACTUATION (DISCONNECT VALVE FAILS TO REMAIN OPEN, REFERENCE FMEA/CIL 03-1-0407-02) CAUSING CLOSING SIDE TO PRESSURIZE DURING LOADING, DETANKING, AND ENGINE OPERATION.

MISSION PHASE: PL PRE-LAUNCH
LO LIFT-OFF

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102	COLUMBIA
103	DISCOVERY
104	ATLANTIS
105	ENDEAVOUR

CAUSE:

PIECE PART STRUCTURAL FAILURE, SEAL/SEAT DAMAGE

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

- A) PASS
- B) FAIL
- C) PASS

PASS/FAIL RATIONALE:

A)

B)

FAILS SCREEN B BECAUSE SOLENOID VALVE DOES NOT HAVE POSITION INDICATOR.

C)

- FAILURE EFFECTS -**(A) SUBSYSTEM:**

LOSS OF REDUNDANCY ONLY. FAILURE RESULTS IN APPLICATION OF ACTUATOR CLOSING PRESSURE. THE DISCONNECT VALVE IS BISTABLE AND WILL REMAIN IN THE LAST COMMANDED POSITION WITH BOTH OPENING AND CLOSING PRESSURE APPLIED. OPENING

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0218-04**

PRESSURE IS NORMALLY APPLIED DURING PROPELLANT LOADING, DETANKING, AND ENGINE OPERATION.

(B) INTERFACING SUBSYSTEM(S):

SAME AS A.

(C) MISSION:

NO EFFECT. THE VALVE WILL REMAIN OPEN.

(D) CREW, VEHICLE, AND ELEMENT(S):

SAME AS C.

(E) FUNCTIONAL CRITICALITY EFFECTS:

CASE 1:

1R/2 2 SUCCESS PATHS. TIME FRAME - LOADING, DETANKING

- 1) PREMATURE ACTUATION OF DISCONNECT VALVE CLOSING SOLENOID (LV49).
- 2) PREMATURE DEACTUATION OF DISCONNECT VALVE OPENING SOLENOID (LV48).

NOTE - LATCH IS NOT DESIGNED OR CERTIFIED TO HOLD PNEUMATICALLY-CLOSED FLAPPER UNDER FLOW CONDITIONS, THEREFORE, NOT CONSIDERED A VALID SUCCESS PATH FOR THIS SCENARIO.

LH2 LOADING OR DETANKING WILL BE TERMINATED. SURGE PRESSURE FROM VALVE CLOSURE MAY CAUSE DAMAGE OR RUPTURE TO THE MPS SYSTEM, DEPENDING ON THE RATE OF CLOSURE. UNABLE TO PERFORM ET DRAIN. RUPTURE OF MPS LINES WILL LEAK LH2 INTO THE AFT COMPARTMENT. POSSIBLE AFT COMPARTMENT OVERPRESSURIZATION AND FIRE/EXPLOSION HAZARD. POSSIBLE LOSS OF CRITICAL FUNCTIONS DUE TO ADJACENT COMPONENT EXPOSURE TO CRYOS. LEAKAGE DETECTABLE USING HGDS. RUPTURE OF ET FEEDLINE WILL LEAK LH2 OUTSIDE OF VEHICLE. FIRE/EXPLOSION HAZARD AND POSSIBLE DAMAGE TO VEHICLE EXTERIOR. POSSIBLE LOSS OF CREW/VEHICLE.

CASE 2:

1R/2 2 SUCCESS PATHS. TIME FRAME - ASCENT

- 1) PREMATURE ACTUATION OF DISCONNECT VALVE CLOSING SOLENOID (LV49).
- 2) PREMATURE DEACTUATION OF DISCONNECT VALVE OPENING SOLENOID (LV48).

SURGE PRESSURE FROM VALVE CLOSURE MAY CAUSE DAMAGE OR RUPTURE TO THE MPS SYSTEM, DEPENDING ON THE RATE OF CLOSURE. RUPTURE OF MPS LINES WILL LEAK LH2 INTO THE AFT COMPARTMENT. POSSIBLE AFT COMPARTMENT OVERPRESSURIZATION AND FIRE/EXPLOSION HAZARD. POSSIBLE LOSS OF CRITICAL FUNCTIONS DUE TO ADJACENT COMPONENT EXPOSURE TO CRYOS. SHUTDOWN OF ALL THREE ENGINES WITH UNCONTAINED DAMAGE DUE TO STARVATION CUTOFF. POSSIBLE LOSS OF CREW/VEHICLE.

NOTE - LATCH IS NOT DESIGNED OR CERTIFIED TO HOLD PNEUMATICALLY-CLOSED FLAPPER UNDER FLOW CONDITIONS, THEREFORE, NOT CONSIDERED A VALID SUCCESS PATH FOR THIS SCENARIO.

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE**NUMBER: 03-1-0218-04**

-DISPOSITION RATIONALE-

(A) DESIGN:

VALVE IS DESIGNED FOR A PRESSURE FACTOR OF SAFETY OF 2.0 PROOF, 4.0 BURST. THE CLOSURE DEVICE IS A 430 CRES BALL ACTING UPON EITHER OF TWO VESPEL SEATS. THE VALVE FEATURES A BALANCED LOAD ON THE BALL BY APPLYING INLET PRESSURE (750 PSIG NOMINAL) DIRECTLY TO THE BALL AT THE INLET SEAT AND INDIRECTLY (VIA A BELLOWS) THROUGH THE VENT SEAT. THE BELLOWS IS ASSISTED BY A SPRING, THE FORCE OF WHICH INSURES THE BALL IS HELD SECURELY AGAINST THE INLET SEAT WHEN THE SOLENOID IS DEENERGIZED. UPON BEING ENERGIZED THE SOLENOID DEVELOPS THE FORCE TO OVERCOME THE SPRING LOAD AND SEATS THE BALL ONTO THE VENT SEAT TO ALLOW HELIUM FLOW. TOTAL POPPET MOVEMENT (STROKE) IS LESS THAN 0.040 INCH.

PREMATURE ACTUATION, FROM THE MECHANICAL VIEW, MEANS APPLICATION OF A DIFFERENTIAL FORCE TO THE VALVE BALL TO CAUSE IT TO MOVE FROM THE INLET SEAT TO THE VENT SEAT. ON THE SOLENOID SIDE OF THE BALL, NO MECHANICAL FAILURES WOULD CAUSE PREMATURE ACTUATION. ON THE OTHER HAND, IF THE CLOSING FORCE OF THE BELLOWS/SPRING WERE REMOVED, INLET PRESSURE AND FLOW ACTING ON THE BALL WOULD DRIVE IT TO THE VENT SEAT, CAUSING PREMATURE ACTUATION.

THE FORCE TO HOLD THE BALL TO THE INLET SEAT, WHEN THE SOLENOID IS DEENERGIZED, IS PROVIDED BY THE BELLOWS ASSEMBLY AND SPRING THROUGH THE VALVE POPPET. IF THE BELLOWS FAILS, OR LEAKS TO THE POINT OF REDUCING THE BELLOWS INTERNAL PRESSURE TO LESS THAN THE VALVE INLET PRESSURE, THE LOAD BALANCING FEATURE IS ELIMINATED AND THE BALL WOULD MOVE TO THE VENT SEAT. THE BELLOWS IS MADE OF NICKEL-COBALT-COPPER AND IS PROOF PRESSURE TESTED AT 1550 PSIG PRIOR TO ASSEMBLY INTO THE VALVE. IF THE SPRING BREAKS, THE PRESSURIZED BELLOWS WOULD EXERT SUFFICIENT FORCE TO RETURN THE BALL TO THE INLET SEAT; HOWEVER, SEAT LEAKAGE MAY RESULT. THE SPRING IS MADE FROM 17-7PH CRES (ELGILOY) WIRE AND IS HEAT TREATED FOLLOWING FORMING. IT HAS A SPRING RATE OF 13.5 POUNDS/INCH AND EXERTS A FORCE OF 7.54 POUNDS IN ITS INSTALLED CONDITION.

PREMATURE ACTUATION DUE TO SEAT/SEAL DAMAGE IS VERY UNLIKELY. THIS PRESUMES FLOW PAST THE SEATED BALL AT A RATE SUFFICIENT TO PRESSURIZE THE ACTUATION PORT TO A PRESSURE OF 400 PSIA MINIMUM, WHILE THE VENT PORT IS OPEN. THE BALL IS OF 430 CRES AND THE SEAT IS OF VESPEL.

THE -0041, -0051 CONFIGURATION SOLENOID VALVES ARE IDENTICAL TO THE -0021 CONFIGURATION WITH THE EXCEPTION OF ADDING THE FILTER (10 MICRON NOMINAL, 25 MICRON ABSOLUTE) IN THE VENT PORT OF THE SOLENOID VALVE AND REDESIGN OF THE VENT PORT CHECK VALVE. THIS FILTER WAS ADDED TO PREVENT CONTAMINATION AND METALLIC PARTICLES GENERATED DURING THE REMOVAL OF THE VENT PORT CHECK VALVE DURING OMRSD LEAKAGE MEASUREMENTS FROM ENTERING THE SOLENOID VALVE.

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0218-04**

THE VENT PORT CHECK VALVE WAS REDESIGNED TO PREVENT THE POPPET FROM BEING EJECTED DUE TO SHEARING OF THE RETAINING NUT THREAD. A PIN WAS ADDED TO THE CHECK VALVE HOUSING, WHICH RETAINS THE POPPET WITHIN THE CHECK VALVE HOUSING. A NEW ALUMINUM NUT, WHICH PROVIDE A MINIMUM ENGAGEMENT OF THREE THREADS, WAS UTILIZED TO INCREASE RELIABILITY.

(B) TEST:
ATP

AMBIENT TEMPERATURE TESTS
PROOF PRESSURE (1560 PSIG); EXTERNAL LEAKAGE (850 PSIG); ELECTRICAL CHARACTERISTICS AND RESPONSE; INTERNAL LEAKAGE (740 PSIG, ENERGIZED AND DEENERGIZED)

REDUCED TEMPERATURE TESTS (-160 DEG F)
ELECTRICAL CHARACTERISTICS AND RESPONSE; INTERNAL LEAKAGE

ELECTRICAL BONDING TESTS

SOLENOID SUBASSEMBLY TESTS
ELECTRICAL CHARACTERISTICS; ENCLOSURE LEAKAGE (ONE ATMOSPHERE)

CERTIFICATION

TWO UNITS

PORT AND FITTING TORQUE

SALT FOG EXPOSURE FOLLOWED BY ELECTRICAL AND LEAKAGE CHECKS

AMBIENT VIBRATION TESTS:
TOTAL 13.1 HOURS BOTH AXES FOR TWO VIBRATION LEVELS PLUS TRANSIENT VIBRATION SWEEP - RUN WITH ONE SPECIMEN ENERGIZED AND ONE DEENERGIZED - FOLLOWED BY ELECTRICAL CHARACTERISTICS AND LEAKAGE CHECKS

HANDLING SHOCK TEST

ENERGIZED AND DEENERGIZED FLOW TESTS

FIFTY HOUR CONTINUOUS CURRENT TEST AT 130 DEG F

AMBIENT TEMPERATURE ENDURANCE (4500 CYCLES FOLLOWED BY ELECTRICAL AND LEAKAGE CHECKS); 130 DEG F ENDURANCE (500 CYCLES FOLLOWED BY ELECTRICAL AND LEAKAGE CHECKS); OPERATION CYCLES (REPEATED 20 TIMES); REPEAT OF AMBIENT TEMPERATURE ENDURANCE ; -160 DEG F ENDURANCE (500 CYCLES FOLLOWED BY ELECTRICAL AND LEAKAGE CHECKS).

DISASSEMBLY AND INSPECTION

BURST PRESSURE (3400 PSIG)

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0218-04**

GROUND TURNAROUND TEST

ANY TURNAROUND CHECKOUT IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

(C) INSPECTION:

RECEIVING INSPECTION

RAW MATERIALS ARE VERIFIED BY INSPECTION FOR MATERIAL AND PROCESSES CERTIFICATION. BODY HOUSING BAR STOCK IS ULTRASONICALLY INSPECTED.

CONTAMINATION CONTROL

CLEANLINESS LEVEL VERIFIED TO 100A. CORROSION PROTECTION IS VERIFIED BY INSPECTION.

ASSEMBLY/INSTALLATION

ALL PARTS ARE PROTECTED FROM DAMAGE AND CONTAMINATION. MICROSCOPIC EXAMINATION OF ALL DETAIL PARTS IS MADE PRIOR TO ASSEMBLY. ALL SURFACES REQUIRING CORROSION PROTECTION ARE VERIFIED. MANDATORY INSPECTION POINTS ARE INCLUDED IN THE ASSEMBLY PROCEDURE. MECHANICAL SURFACE FINISH AT 125 RMS IS INSPECTED AND VERIFIED WITH A PROFILOMETER. SURFACE FINISHES SMOOTHER THAN 125 RMS ARE INSPECTED USING A COMPARATOR AT 10X MAGNIFICATION. ALL CRITICAL DIMENSIONS ARE VERIFIED BY INSPECTION.

CRITICAL PROCESS

HEAT TREATMENT AND PARTS PASSIVATION VERIFIED BY INSPECTION. POTTING OF SOLDER CUPS, ELECTRICAL WIRE STRIPPING, AND SOLDERING OF CONNECTORS ARE VERIFIED BY INSPECTION. DRY FILM LUBRICATION APPLIED TO THE PLUNGER IS VERIFIED BY INSPECTION.

NONDESTRUCTIVE EVALUATION

WELDS VISUALLY EXAMINED & VERIFIED BY X -RAY, DYE PENETRANT, AND EDDY CURRENT. THE SOLENOID ASSEMBLY IS SUBJECTED TO LEAKAGE VERIFICATION USING RADIOACTIVE TRACER TECHNIQUES. THE VALVE BODY, PRIOR TO FINAL MACHINING, IS SUBJECTED TO ETCH AND DYE PENETRANT INSPECTION. BELLOWS ASSEMBLY IS PROOF PRESSURE TESTED AND LEAK CHECKED.

TESTING

ATP VERIFIED BY INSPECTION.

HANDLING/PACKAGING

PACKAGING FOR SHIPMENT VERIFIED BY INSPECTION.

(D) FAILURE HISTORY:

LEAKAGE RESULTING FROM SEAL/SEAT DAMAGE (OR CONTAMINATION) HAS OCCURRED BUT HAS NOT BEEN OF SUFFICIENT MAGNITUDE TO CAUSE PREMATURE ACTUATION (REFERENCE FMEA/CIL 0291-1, SOLENOID EXTERNAL LEAKAGE THROUGH VENT PORT).

CURRENT DATA ON TEST FAILURE, FLIGHT FAILURE, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATABASE.

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0218-04**

(E) OPERATIONAL USE:
NO CREW ACTION CAN BE TAKEN.

- APPROVALS -

S&R ENGINEERING	: W.P. MUSTY	:/S/ W. P. MUSTY
S&R ENGINEERING ITM	: P. A. STENGER-NGUYEN	:/S/ P. A. STENGER-NGUYEN
DESIGN ENGINEERING	: DAVE NEARY	:/S/ DAVE NEARY
MPS SUBSYSTEM MGR.	: TIM REITH	:/S/ TIM REITH
MOD	: JEFF MUSLER	:/S/ JEFF MUSLER
USA SAM	: MIKE SNYDER	:/S/ MIKE SNYDER
USA ORBITER ELEMENT	: SUZANNE LITTLE	:/S/ SUZANNE LITTLE
NASA SR&QA	: ERICH BASS	:/S/ ERICH BASS