# FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL HARDWARE

NUMBER: 05-6BA-2413 -X

SUBSYSTEM NAME: EPD&C - LANDING GEAR CONTROL

REVISION:	Û	02/25/88

PART DATA			
	PART NAME VENDOR NAME	PART NUMBER VENDOR NUMBER	
LRU	: FWD LCA 2	MC450-0055-0001	
LRU	FWD LCA 2	MC450-0055-0002	
LRU	: FWD LCA 3	MC450-0056-0001	
LRU	: FWD LCA 3	MC450-0056-0002	
BRU	: CONTROLLER, HYBRID DRIVER	MC477-0262-0002	

# EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

CONTROLLER, HYBRID DRIVER (HDC), TYPE II, NOSE LANDING GEAR EXTENSION POWERED ASSIST NO. 1 AND NO. 2

REFERENCE DESIGNATORS:

82V76A17AR(2)

83V76A18AR(2)

QUANTITY OF LIKE ITEMS: 4

FOUR, 2/ FLCA 2 & 3

#### **FUNCTION:**

WITH NOSE LANDING GEAR ARM AND DOWN STIMULI, THE HDC DELAYS ITS OUTPUT BY ONE SECOND TO THE FIRE 1 CIRCUIT AND SIGNALS SERIES HDC WHICH DELAYS FIRE 2 COMMAND ANOTHER SECOND TO THE ASSOCIATED PIC FOR NOSE LANDING GEAR EXTENSION POWERED ASSIST FUNCTION.

FAILURE MODES EFFECTS ANALYSIS FMEA - CIL FAILURE MODE

NUMBER: 05-6BA-2413-01

REVISION#:

1

06/28/99

SUBSYSTEM NAME: EPD&C - LANDING GEAR CONTROL

LRU: FWD LCA 2

CRITICALITY OF THIS

ITÉM NAME: CONTROLLER, HYBRID DRIVER

FAILURE MODE: 1R2

FAILURE MODE: LOSS OF OUTPUT

MISSION PHASE:

DO DE-ORBIT

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY 104 ATLANTIS

105 ENDEAVOUR

CAUSE:

ı

PIECE PART FAILURE, MECHANICAL SHOCK, VIBRATION, CONTAMINATION, THERMAL

STRESS, PROCESSING ANOMALY

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) FAIL

C) PASS

PASS/FAIL RATIONALE:

A)

B)

FAILS "B" SCREEN BECAUSE HYBRID DRIVER FAILURE IS NOT FLIGHT DETECTABLE.

C)

#### - FAILURE EFFECTS -

## (A) SUBSYSTEM:

FIRST FAILURE - LOSS OF CAPABILITY TO CONDUCT FIRE 1 OR FIRE 2 COMMANDS TO ASSOCIATED PIC.

## (B) INTERFACING SUBSYSTEM(S):

## FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE NUMBER: 05-6BA-2413- 01

FIRST FAILURE - LOSS OF ONE OF TWO PICS FOR NOSE LANDING GEAR EXTENSION PYRO POWERED ASSIST SUBSYSTEM.

### (C) MISSION:

FIRST FAILURE - NO EFFECT, SECOND FAILURE (HYBRID DRIVER IN REMAINING REDUNDANT NOSE GEAR EXTENSION POWERED ASSIST FUNCTION) - NOSE LANDING GEAR MAY FAIL TO EXTEND IN REQUIRED TIME CAUSING POSSIBLE LOSS OF CREW/VEHICLE.

# (D) CREW, VEHICLE, AND ELEMENT(S):

FIRST FAILURE - NO EFFECT. SECOND FAILURE (HYBRID DRIVER IN REMAINING REDUNDANT NOSE GEAR EXTENSION POWERED ASSIST FUNCTION) - NOSE LANDING GEAR MAY FAIL TO EXTEND IN REQUIRED TIME CAUSING POSSIBLE LOSS OF CREW/VEHICLE.

# (E) FUNCTIONAL CRITICALITY EFFECTS:

## -DISPOSITION RATIONALE-

#### (A) DESIGN:

REFER TO APPENDIX B, ITEM NO. 1 - HYBRID DRIVER

### (B) TEST:

REFER TO APPENDIX B, ITEM NO. 1 - HYBRID DRIVER

#### GROUND TURNAROUND TEST

ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

### (C) INSPECTION:

REFER TO APPENDIX B, ITEM NO. 1 - HYBRID DRIVER

### (D) FAILURE HISTORY:

CURRENT DATA ON TEST FAILURES, FLIGHT FAILURES, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATA BASE.

## (E) OPERATIONAL USE:

# FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE NUMBER: 05-6BA-2413-01

NONE

- APPROVALS -

EDITORIALLY APPROVED

TECHNICAL APPROVAL

: BNA

: VIA APPROVAL FORM

: J. Kemusa 7/6/99: 96-CIL-011\_05-5BA(2)