CRITICAL ITEMS LIST (CIL)

SYSTEM:

ASI

SUBSYSTEM:

ET Interface Hardware

FUNCTIONAL CRIT: PHASE(S):

REV & DATE:

DCN & DATE: ANALYSTS:

J, 12-19-97

HAZARD REF:

5.11

FAILURE MODE:

Structural Failure

C. Rush/E. Howell

FAILURE EFFECT:

Loss of mission and vehicle/crew due to collapse of interface system resulting in fire/explosion or debris source to Orbiter.

TIME TO EFFECT:

Immediate

FAILURE CAUSE(S):

A; Improper Manufacture

B:

Failure of Attaching Hardware (Debris Source) C:

REDUNDANCY SCREENS:

Not Applicable

FUNCTIONAL DESCRIPTION: Provides aft support interface for RH Orbiter/ET attach.

FMEA ITEM	PART NO.	PART NAME	OTY	EFFECTIVITY
4.5.18.1	80911071764-019	Ball Fitting Assembly (E0-3)	1	LWT-54 & Up

REMARKS:			

CRITICAL ITEMS LIST (CIL) CONTINUATION SHEET

SYSTEM: SUBSYSTEM: ASI

ET Interface Hardware

REV & DATE: DCN & DATE: J. 12-19-97

FMEA ITEM CODE(S):

4.5.18.1

DCN & DAT

RATIONALE FOR RETENTION

DESIGN:

A-C: The fitting is machined from 7050-T74 aluminum alloy forging. Materials selected for this part number are in accordance with MMC-ET-SE16 which assures repetitive conformance of composition and properties. Part integrity is assured by ultrasonic inspection per MIL-I-8950 and penetrant inspection per STP2501. The ball fitting and attachment hardware are designed to the required ultimate safety factor of 1.4 (ET Stress Report 826-2188).

B, C: Attaching hardware is selected from the Approved Standard Parts List (ASPL 826-3500), installed per STP2014 and torqued using values specified on Engineering drawings. Tensile installation loads are sufficient to provide screening for major flaws in individual fasteners.

TEST:

The Ball Fitting Assy (E0-3) is certified. Reference HCS MMC-ET-TMO8-L-S115 (LWT-54 thru 88) and HCS MMC-ET-TMO8-L-S516 (LWT-89 & Up).

Vendor:

8, C: Attaching fasteners are procured and tested to standard drawings 26L2 and 33L2.

INSPECTION:

A:

Vendor Inspection - Lockheed Martin Surveillance:

A-C: Verify materials selection and verification controls (MMC-ET-SE16, STM5168, STM-0-250, drawings 80911071772 and standard drawings 26L2 and 33L2).

A: Inspect dimensional conformance (80911071764).

A: Ultrasonic inspect part (80911071772).

Penetrant inspect part (drawing 80911071764 and STP2501 Type 1 Method A and C).

MAF Quality Inspection:

Inspect that attaching hardware is free from damage (drawing 80911071790 and STP2014).

A-C: Verify installation and witness torque (drawing 80911071790).

Launch Site:

A: Inspect condition of ball fitting surface (OMRSD File II).

FAILURE HISTORY:

Current data on test failures, unexplained anomalies and other failures experienced during ground processing activity can be found in the PRACA data base.