2111		

1401	5	28V POWER SUPPLY GIY-1 (ORBITER SYSTEM). PS 90128. WL 90128. ED 85511	HODE: LOSS OF 28V DC IN DIRECT MODE. CAUSE(S): (1) INPUT FILTER	IF DIRECT DRIVE "POSITIVE" COMMANDED, JOINT DRIVES IN "NEGATIVE" DIRECTION. BRAKES "ON"	THE 28VDC FILTER INCLUDES TWO FEED THROUGH FILTERS, QUALIFIED TO MIL-F-15733, ADDITIONAL CONFROL IS IMPOSED BY CAE
			FAILURE (OPEN).	BYANES "J" FOR OTHER JOINTS. AUTO BRAKES WHEN COMMAND REMOVED. NO MOVEMENT FOR "MEGATIVE" COMMAND. LOSS OF EE MANUAL DRIVE MODE. EE AUTO DRIVE MODE IS STILL AVAILABLE. MORST CASE UNEXPECTED MOTION. WRONG JOINT DIRECTION. CREW ACTION REQUIRED REDUNDANT PATHS REMAINING N/A	PROCUREMENT SPEC. WHICH ENSURES COMPLIANCE WITH THE SCREENING REQUIREMENTS OF SPAR-RMS-PA.003.  EEE PARTS HAVE BEEN SELECTED AND CONTROLLED IN ACCORDANCE WITH SPAR-RMS-PA.003. THIS DOCUMENT DEFINES THE PROGRAM REQUIREMENTS FOR MONITORING AND CONTROLLING EEE PARTS. THE REQUIREMENTS INCLUDE PARTS SELECTION TO AN LEAST "ESTABLISHED RELIABILITY" LEVELS, AND ADEQUATE DERATING OF PART STRESS LEVELS. PROCEDURES AND ACTIVITIES ARE SPECIFIED TO ENSURE AT LEAST EQUIVALENT QUALITY FOR MONSTANDARD AND RREGULAR PARTS. RELIABILITY ANALYSIS HAS CONFIRMED NO PARTS MITH GENERICALLY HIGH FAILURE RAIES. AEROSPACE DESIGN STANDARDS FOR DETAILING ELECTRONIC PARTS PACKAGING, MOUNTING AND STRUCTURAL/MECHANICAL/INTEGRITY OF ASSEMBLIES ARE APPLIED. SUCH DESIGN AND SER REPLIABILITY MAINTAINABILITY AND SAFETY CHECKLISTS. MATERIALS COTOR THROUGH THE DESIGN AUDIT PROCESS, INCLUDING THE USS OF RELIABILITY MAINTAINABILITY AND SAFETY CHECKLISTS. MATERIALS USAGE REQUIREMENTS. WORST CASE ANALYSIS HAS BEEN CONDUCTED TO ENSURE THAT PERFORMANCE CAN BE MET UNDER MORST CASE TEMPERATURE AND AGING EFFECTS. EEE PARTS STRESS ANALYSIS HAS BEEN CONDUCTED TO ENSURE THAT PERFORMANCE CAN BE MET UNDER MORST CASE TEMPERATURE AND AGING EFFECTS. EEE PARTS STRESS ANALYSIS HAS BEEN CONDUCTED TO ENSURE HAT PERFORMENT SOUTH THE PARTS MEET THE DERATING REQUIREMENTS.  PRINTED CIRCUIT BOARD DESIGNS HAVE BEEN REVIEWED TO ENSURE ADEQUATE CIRCUIT PAIR VIDIN AND SEPARATION AND TO CONFIRM APPROPRIATE DIMENSIONS OF CIRCUIT SOLDER PADS AND OF COMPONENT HOLE PROVISIONS.  PARTS MOUNTING METHODS ARE CONTROLLED IN ACCORDANCE WITH MSFC-STD-136 AND CAE POSSABO. THESE DOCUMENTS REQUIRE APPROVED-MOUNTING METHODS, STRESS RELIEF, AND COMPONENT SECURITY.  WHERE APPLICABLE, DESIGN DRAWINGS AND DOCUMENTATION GIVE CLEAR IDENTIFICATION OF HANDLING PRECAUTIONS FOR ESD SENSITIVE PARTS.  BOARD ASSEMBLY DRAWINGS INCLUDE THE REQUIREMENT FOR SOLDERING STANDARDS IN ACCORDANCE WITH NHB 5300.4(3A) AND JSC 08800A.
	I		, <u> </u>		

MEA FMEA REF. REV.	NAME OTY & DRAVING RÉF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END TIEM	HOWR / FUNC. RATIONALE FOR ACCEPTANCE
1401 5	28V POWER SUPPLY 01Y-1 (ORBITER SYSTEM). PS 90128. WL 90128. ED 65511	MODE: LOSS OF 28V DC 1M DIRECT MODE.  CAUSE(S): (1) IMPUT FILTER FAILURE (OPEN).	IF DIRECT DRIVE "POSITIVE" COMMANDED, JOINT DRIVES IN "NEGATIVE" DIRECTION. BRAKES "ON" FOR OTHER JOINTS, AUTO BRAKES WHEN COMMAND REMOVED. NO MOVEMENT FOR "NEGATIVE" COMMAND. LOSS OF EE MANUAL DRIVE MODE. EE AUTO DRIVE MODE IS STILL AVAILABLE.  WORST CASE UNEXPECTED MOTION. WRONG JOINT DIRECTION CREW ACTION REQUIRED  REDUNDANT PATHS REMAINING N/A	ACCEPTANCE TESTS  THE MARDWARE ITEM IS SUBJECTED TO THE FOLLOWING ACCEPTANCE ENVIRONMENTAL TESTING AS PART OF THE DBC PANEL.  O VIBRATION: LEVEL AND DURATION - REFERENCE TABLE 1  O THERMAL: +100 DEGREES F TO +100 DEGREES F 2 CYCLES (P.5 MRS PER CYCLE)  THE DBC PANEL ASSEMBLY IS FURTHER TESTED AS PART OF THE RMS SYSTEM (IPSIB RMS STRONGOBACK TEST AND IPSS2 FLAY FLOOR TEST) WHICH VERTIEST INE ABSENCE OF THE FAILURE MODE.  OUALIFICATION TESTS  THE DBC PANEL HAS BEEN SUBJECTED TO THE FOLLOWING QUALIFICATION TEST ENVIRONMENT:  O VIBRATION: LEVEL AND DURATION - REFERENCE TABLE 1  O SHOCK: 200/11NS - 3 AKS (6 DIRECTION)  O THERMAL: 130 DEGREES F TO 23 DEGREES F (12 MRS PER CYCLE) (6 CYCLES) OCT.  O HUMIDITY: 95% (120 DEGREES F TO 82 DEGREES F CYCLE IN 16 HRS) 10 CYCLES TOTAL  O EMC: 16 HRS) 10 CYCLES TOTAL  O EMC: MIL-STD-461 AS MODIFIED BY SL-E-0002 (TEST CEO1, CE CEO3, CSO1(CC/AC), CSO2, CSO6, REO2 (B/N), RSO2, RSO3, RSO3, RSO3), RSO3, RSO

PROJECT: SRMS (-5 MCLU INSTALLED)
ASS'Y NOMENCLATURE: D&C PANEL

SYSTEM: D&C SUBSYSTEM ASS'Y P/N: 51140E391

SHEET: 3

FMEA REF.	THEA REV.	NAME, QTY, & DRAWING REF.	FAILURE MODE	FAILURE EFFECT	HDWR / FUNC.	RATIONALE FOR ACCEPTANCE
		DESIGNATION	CAUSE ,	END TEM	CRITICÁLITY	SCREENS: N/A
1401	5	28V POWER SUPPLY GTY-1 (ORBITER SYSTEM). PS 90128. ML 90128. ED 85511	HODE: LOSS OF 28V DC IN DIRECT HODE.  CAUSE(\$): (1) INPUT FILTER FAILURE (OPEN).	IF DIRECT ORIVE "POSITIVE" COMMANDED, JOINT DRIVES IN "MEGATIVE" DIRECTION." BRAKES "ON" FOR OTHER JOINTS. AUTO BRAKES WHEN COMMAND REMOVED. NO MOVEMENT FOR "NEGATIVE" COMMAND. LOSS OF EE MANUAL DRIVE MODE. EE AUTO DRIVE MODE IS STILL AVALLABLE. WORST CASE UNEMPECTED MOTION. WRONG JOINT DIRECTION. CREW ACTION REQUIRED  REDUNDANT PATHS REMAINING N/A	SPAR-RMS-PA, OO TO THE REQUIRE PARTS ARE 100X REQUIRED BY SP EEE PARTS ARE REQUIREMENTS, FACILITY. DPA SELECTED 5X O EACH LOT MUMBE  WIRE IS PROCUR AND IMSPECTED  RECEIVING INSP IDENTIFIED IN DAMAGE HAS OCC RECEIVING DOCU AND SCREEMING  PARTS ARE INSP APPROPRIATE TO IMSPECTIONS IN PRINTED CIRCUI AND ADEQUACY OF COMPONENT HOUN LOOPING, STRAP AND CERTIFIED BY JSC 05800A.  CONFORMAL COAT PERFORMED USIN POST P.C. BD. WORKMANSHIP (S P.C. BD. INST/ INSTALLATION, MATING, WIRE R PRE-TEST INSPE OF LOWER TIER VERIFICATION IN MANDATORY INSP A TEST READING TEST PERSONNEL VALIDATION STR A TEST READING RELIABILITY (S AND THE GOVEN) RELIABILITY (S AND THE GOVEN) RELIABILITY (S AND THE GOVEN)	PECTION IS PERFORMED AS REQUIRED BY  13. EACH EEE PART IS QUALIFIED AT THE PART LEVEL  13. EACH EEE PART IS QUALIFIED AT THE PART LEVEL  13. EACH EEE PART IS QUALIFIED AT THE PART LEVEL  14. SCREEMED AND BURNED IN, AS A MINIMUM, AS  15. PAR-MS-PA.003, BY THE SUPPLIER. ADDITIONALLY,  15. PARTS. PROPERTOR IN ACCORDANCE WITH  15. PERFORMED AS REQUIRED BY PA.003 ON A RANDOMLY  15. PERFORMED AS REQUIRED BY PA.003 ON A RANDOMLY  15. PARTS, MAXIMUM 5 PIECES, MINIMUM 3 PIECES FOR  16. PARTS, MAXIMUM 5 PIECES, MINIMUM 3 PIECES FOR  17. PARTS, MAXIMUM 5 PIECES, MINIMUM 3 PIECES FOR  18. PECTED TO PARTS RECEIVED.  18. PECTEON VERIFIES THAT ALL PARTS RECEIVED ARE AS  18. THE PROCUREMENT DOCUMENTS, THAT NO PHYSICAL  19. PROTOCOMENTS DURING SHIPMENT, THAT THE  19. MENTS PROVIDE ADEQUATE TACCABLITY INFORMATION  19. DATA CLEARLY IDENTIFIES ACCEPTABLE PARTS.  19. THE MANUFACTURING STAGE COMPLETED. THESE  10. THE MANUFACTURING STAGE COMPLETED. THESE  10. PLATED THROUGH HOLES,  11. HORD INSPECTION FOR CORRECT SOLDERING, WIRE  15. PLATED THROUGH FOR CORRECT SOLDERING, WIRE  15. PPING, ETC. OPERATORS AND INSPECTORS ARE TRAINED  15. NASA NHB 5300.4(3A) STANDARD, AS MODIFIED

PREPARED BY:

MF NG\_\_

SUPERCEDING DATE: 29 SEP 87

APPROVED BY:

DATE: 24 JUL 91

CIL REV: 5

PREPARED BY:

MFMG

PROJECT: SRMS (-5 MCIU INSTALLED)
ASS'Y NOMENCLATURE: D&C PANEL

SYSTEM: D&C SUBSYSTEM ASS'Y P/N: 51140E391. SHEET: FATLURE MODE FAILURE EFFECT HDWR / FUNC. NAME, OTY, & RATIONALE FOR ACCEPTANCE REF. DRAWING REF. AND ON 1/1 REV. END ITEM CRITICALITY DESIGNATION CAUSE SCREENS: N/A IF DIRECT DRIVE THERMAL AND VIBRATION TESTING, (SPAR/GOVERNMENT REP. .. 1401 5 28V POWER HODE: LOSS OF 28V "POSITIVE" MANDATORY INSPECTION POINT). SUPPLY QTY-1 DC IN DIRECT COMMANDED. INTEGRATION OF DEC PANEL, RHC, THE AND MEIU, IMSPECTIONS ARE PERFORMED AT EACH STAGE OF INTEGRATION, WHICH INCLUDES GROUNDING CHECKS, INTER CONNECT CABLE VERIFICATION, CONNECTOR INSPECTION FOR BENT OR PUSHBACK CONTACTS ETC. HODE . JOINT DRIVES IN CORBITER "HEGATIVE" SYSTEM). PS 90128. WL 90128. ED 85511 CAUSE(S): DIRECTION. BRAKES "OH" FOR OTHER (1) INPUT SUB-SYSTEM PERFORMANCE TESTING (ATP), INCLUDES AN AMBIENT PERFORMANCE TEST. (MANDATORY INSPECTION POINT). FAILURE JOINTS. AUTO BRAKES (OPEN). WHEN COMMAND SRMS SYSTEMS INTEGRATION, THE INTEGRATION OF MECHANICAL ARM SUBASSEMBLIES AND THE FLIGHT CABIN EQUIPMENT TO FORM THE SRMS. REMOVED. NO MOVEMENT FOR INSPECTIONS ARE PERFORMED AT EACH PHASE OF INTEGRATION WHICH "HEGATIVE" INCLUDES GROUNDING CHECKS, THRU WIRING CHECKS, WIRING ROUTING, INTERFACE CONNECTORS FOR BENT OR PUSH BACK CONTACTS ETC. COMMAND. LOSS OF EE SRMS SYSTEMS TESTING - STRONGBACK AND FLAT FLOOR AMBIENT MANUAL DRIVE PERFORMANCE TEST. (SPAR/GOVERNMENT REP. - MANDATORY INSPECTION MODE. EE AUTO DRIVE HODE IS STILL AVAILABLE. WORST CASE UNEMPECTED NOTION. WRONG DIRECTION. CREW ACTION REQUIRED REDUNDANT PATHS REMAINING H/A

RMS/D&C - 327

APPROVED BY:

SUPERCEDING DATE: 29 SEP 87

DATE: 24 JUL 91

CIL REV: 5

PROJECT: SRMS (-5 MCIU INSTALLED)

ASS'Y HOMENCLATURE: DEC PAREL

FAILURE EFFECT | HDWR / FUNC. RATIONALE FOR ACCEPTANCE

FNEA REF.	FMEA REV.	NAME OTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END TIEN	HDWR / FUNC. 1/1 Criticality	RATIONALE FOR ACCEPTANCE SCREENS: M/A	
1401	5	28V POWER SUPPLY GTY-1 (ORBITER SYSTEM). PS 90128. UL 90128. ED 85511	MODE: LOSS OF 2BV DC IM DIRECT MODE.  CAUSE(S): (1) INPUT FILTE FAILURE (OPEM).	IF DIRECT DRIVE "POSITIVE" COMMANDED, JOINT ORIVES IN "NEGATIVES IN "NEGATIVES IN BRAKES "ON" FOR OTHER JOINTS, AUTO BRAKES WHEN COMMAND REMOVED. NO MOVEMENT FOR "MEGATIVE" COMMAND. LOSS OF EF MANUAL DRIVE MODE. EE AUTO DRIVE MODE IS STILL AVAILABLE. WORST CASE UNEXPECTED MOTION. WRONG JOINT DIRECTION. CREW ACTION REQUIRED  REDUNDANT PATHS REMAINING N/A	FAILURE HIST	DEEN NO FAILURES ASSOCIATED WITH THIS FAILURE SRMS PROGRAM.	
REPARED 0	7: <u>₩</u>	FNG	SUPERCEDING DATE	L: <u>E7</u> JL: 01		PAIL FT VOL Y	CIL REV:

PREPARED 8Y: MENG SUPERCEDING DATE: 29 SEP 87 APPROVED 8

PROJECT: SRMS (-5 MCIU INSTALLED)
ASS'Y HOMENCLATURE: QBC PANEL

\$00.00 to \_\_\_6

FMEA REF.	FMEA REV.	NAME OTY, & Drawing Ref. Designation	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HDUR / FUNC. RATIONALE FOR ACCEPTANCE 1/1 CRITICALITY SCREENS: N/A
1401	5	28V POWER SUPPLY GIY-1 (ORBITER SYSIEM). PS 90128. ML 90128. ED 85511	MODE: LOSS OF 28V DC IN DIRECT MODE.  CAUSE(\$): (1) INPUT FILIER FAILURE (OPEN).	IF DIRECT DRIVE "POSITIVE" COMMANDED, JOINT DRIVES IN "NEGATIVE" DIRECTION. BRAKES "ON" FOR OTHER JOINTS. AUTO BRAKES WHEM COMMAND REMOVED. HO MOVEMENT FOR "NEGATIVE" COMMAND. LOSS OF EE MANUAL DRIVE MODE IS STILL AVAILABLE. MORST CASE UNEXPECTED HOTION. WRONG JOINT DIRECTION. CREW ACTIOM REQUIRED  REDUNDANT PATHS REMAINING N/A	DIRECT DRIVE CAN NOT BE USED TO COMPLETE THE MISSION. COMPUTER SUPPORTED MODES OR BACKUP REMAIN. MISSION CAN BE COMPLETED IN OTHER AVAILABLE MODES.  CREW ACTION  REMOVE COMMAND.  CREW TRAINING  THE CREW SHOULD BE TRAINED TO ALAMAYS OBSERVE WHETHER THE ARM IS REPONDING PROPERLY TO COMMANDS. IF IT IS NOT THE COMMAND SHOULD BE REMOVED.  MISSION CONSTRAINT  OPERATE AT LESS THAN VERNIER RATES WITHIN 10FT. OF STRUCTURE BY CYCLING SWITCH. OPERATOR MUST BE ABLE TO DETECT THAT THE ARM IS RESPONDING PROPERLY TO COMMANDS VIA WINDOW AND/OR CCTV VIEWS DURING ALL ARM OPERATIONS.  OMESD OFFLIME  WITH SAFING SWITCH IN 'AUTO' VERIFY VOLTAGE AT LONGERON INTERFACE.  ORRSD ONLINE INSTALLATION  WITH SAFING SWITCH IN 'AUTO' VERIFY VOLTAGE AT LONGERON INTERFACE.  ORRSD ONLINE TURNAROUND  WITH SAFING SWITCH IN 'AUTO' SELECT SINGLE AND DRIVE ANY JOINT. VERIFY TACHOMETER SIGNATURE.