REF.	REV.	DRAWING REF. DESIGNATION	VATLURE RODE AND CAUSE	FAILURE CET ON END TEN	HOUR / FUNC.  3/1RAB RATIONALE FOR ACCEPTANCE  CRITICALITY
4650		SHOULDER FUSING. 45 PRINE CHANNEL FUSES. 16 BACK-UP CHANNEL FUSES. WIRTING SCHEMATIC 51140E316 REVISION C.	MODE: LOSS OF TV CAMERA PAN AND TILT FUSE.  CAUSE(S): (1) RECHANICAL SHOCK VIORATION MATERIALS (FUSES 38 THROUGH 41)	OME OF FOUR 28V SUPPLY LINES LOST. INCREASE IN VOLTAGE DROP TO THE EQUIPMENT. NO EFFECT VILL BE NOTICED.  WORST CASE NO EFFECT ON CREM/VEHICLE OR MISSION.  REDUMDANT PATHS REMAINING 3 FUSES	FUSES USED IN THE SHOULDER FUSE PLUG ASSENBLIES ARE OF THE DESIGN DEFINED BY MSFC SPECIFICATION 40M38259. FOR SMMS APPLICATION, DESIGN AND PROCESS IMPROVEMENTS NAVE BEEN MEGOTIATED WITH, AND IMPLEMENTED BY, THE MANUFACTURER.  - IMPROVED ATTACHMENT OF END CAPS CONTROL OF FUSE ELEMENT LENGTH AND DISPOSITION WITHIN THE FUSE BODY TUBE CONTROL SOLDERING BETWEEN FUSE ELEMENT AND THE END CAPS.  PRIOR TO ASSEMBLY IN THE FUSE PLUG ASSEMBLY, A CONNECT PIN IS SOLDERED TO EACH OF THE FUSE LEAD WIRES. THIS PROCESS IS CONTROLLED BY ESTABLISHED PROCEDURES WHICH INCLUME THE REQUIREMENT OF A "METERED" QUALITY OF SOLDER FOR EACH SOLDER JOINT. THE FUSE BODY AND LEAD WIRES ARE SLEEVED TO PRECLUDE SHORT CIRCUITS. EACH FUSE MAD ALL SOLDERED JOINTS ARE SUBJECTED TO RADIOGRAPHIC INSPECTION.  THE FUSE PLUG ASSEMBLY INCLUDES AN ALUMINUM POTTING SMELL. FOLLOWING INTEGRATION OF THE FUSES, THE CONNECTOR ASSEMBLY IS POTTED USING A SENI-RESILIEUT (ATV) COMPOUND. THE POTTING MEDIUM PROVIDES GOOD HEAT TRANSFER AND ENSURES MECHANICAL STABILITY OF THE INDIVIDUAL FUSES.  POWER TO THE END EFFECTOR HEATERS IS COMOUNTED BY 2 PARALLEL WIRES, EACH OF WHICH IS PROTECTED BY A 5 AMP FUSE.

PREPARED BY: MING SUPERCEDING DATE: 28 OCT 86

APPROVED BY:

^4IE: \_\_\_\_

## CRITICAL ITEMS LIST

PROJECT: SAMS
ASS'Y NOMENCLATURE: SHOULDER

SYSTEM: NECHANICAL ARM SUBSYSTEM
ASS'Y P/H: \$TT\$0J7279 SHEET: 2

REF.	REV.	DRAVING REF. DESIGNATION	FATEURE NODE AND CAUSE	FATEURE EFFECT ON END ITEM	ROCK / FORC. 3/1RAD RATIONALE FOR ACCEPTANCE CRITICALITY
4650		SHOULDER FUSING. 45 PRIME CRAMMEL FUSES. 16 BACK-UP CHAMMEL FUSES. WIRING SCHEMFIC STITAGESTIG REVISION C.	HODE: LOSS OF TY CAMERA PAN AND TILT FUSE.  CAUSE(\$): (1) RECHANICAL SNOCK YUBRATION MATERIALS (FUSES 38 THROUGH 41)	ONE OF FOUR 20V SUPPLY LINES LOST. INCREASE IN VOLTAGE DROP TO THE EQUIPMENT. NO EFFECT WILL BE NOTICED. WORST CASE NO EFFECT ON CREW/VEHICLE OR MISSION. REDUNDANT PATHS REMAINING 3 FUSES	ACCEPTANCE TESTS  THE SHOULDER, ELBOW AND WRIST JOINTS ARE SUBJECTED TO THE FOLLOWING ACCEPTANCE ENVIRONMENTAL TESTING.  O VIBRATION: LEVEL AND DURATION - REFERENCE TABLES 9, 10 AND 11.  O THERMAL: +70 DEGREES C TO -25 DEGREES C (2 CYCLES)  1 x 10°6 form.  THE JOINTS ARE INTEGRATED 1810 THE RMS SYSTEM (PER 1P532) WHICH IS FURTHER TESTED IN (1P518 RMS STRONGBACK AND 1P552 FLAT FLOOR). THESE TESTS VERTFIES THE ABSENCE OF THE FAILURE MODE.  GUALIFICATION TESTS  THE SMOULDER AND WRIST JOINTS WERE SUBJECTED TO THE LISTED RELOW ENVIRONMENTS. INC ELBOW JOINTS WAS NOT EMPOSED THE GUALIFICATION ENVIRONMENTS WAS CERTIFIED BY SIMILARITY TO THE SHOULDER JOINT OF SHOULDER JOINT OF STATE OF S

PREA REF.	REV.	DRAWING REF. DESIGNATION	FAILURE MUDE AND CAUSE	FATEURE EFFECT ON ENU ITEM	HOUR / FUNC. 3/1RAB RATIONALE FOR ACCEPTANCE CRITICALITY
4650		SHOULDER FUSING. 45 PRINE CHANNEL FUSES. 16 BACK-UP CHANNEL FUSES. WIRING SCHEMATIC 511406316 REVISION C.	NODE: LOSS OF TY CAMERA PAN AND TILT FUSE.  CAME(S): (1) NECHANICAL SHOCK HORATION HATERIALS (FUSES 36 THROUGH 41)	ONE OF FOUR 28V SUPPLY LINES LOST, INCREASE IN VOLTAGE DROP TO THE EQUIPMENT, NO EFFECT WILL BE MOTICED.  WORST CASE  NO EFFECT ON CREW/VEHICLE ON MISSION.  REDAINDANT PATHS REMAINING 3 FUSES	GAZINSPECTIONS  FUSES ARE PROCURED AS A EEE PART TO SPAR SPECIFICATION SPAR-80459/073, UNION INCORPORATES SPECIFICATION MSFEGON30259 AS REQUIRED BY JPAR-8NS-PA.003, OMALTFICATION ACCEPTANCE TESTING AND MICHAELIZATION LIFE TESTING OF FUSE FUG ASSEMBLIES MAS PERFORMED TO THE REQUIREMENTS OF THE SPAR-8NS-TP.922.  EEE PARTS INSPECTION IS PERFORMED AS REQUIRED BY SPAR-8NS-PA.003, EACH EEE PART IS QUALIFIED AT THE PART LEVEL TO THE REQUIREMENTS OF THE APPLICABLE SPECIFICATION. ALL EEE PARTS ARE 100% SCREENED AND BURNED IN, AS A MINIMUM, AS REQUIREMENTS OF SPAR-8NS-PA.003, BY THE SUPPLIER. ADDITIONALLY, EEE PARTS ARE 100% SCREENED AND BURNED IN, AS A MINIMUM, AS REQUIREMENTS, BY AN INDEPENDENT SPAR APPROVED TESTING FACILITY. OPA IS PERFORMED AS REQUIRED BY PA.003 ON A RANDONLY SELECTED 3% OF PARTS, MAINIMUM SPIECES, MINIMUM SPIECES FOR EACH LOT MEMBER/DATE CODE OF PARTS RECEIVED.  WIRE IS PROCURED TO SPECIFICATION MIL-U-22759 OR MIL-U-81381 AND INSPECTED AND TESTED TO MASA JSCHOOD STANDARD MEMBER 95A.  RECEIVING INSPECTION VERIFIES THAT ALL PARTS RECEIVED ARE AS IDENTIFIED IN THE PROCUREMENT DOCUMENTS, THAT NO PHYSICAL DAMAGE ARS OCCURED TO PARTS DURING SHIPMENT, THAT THE RECEIVING DOCUMENTS PROVIDE ADEQUATE TRACEABILITY INFORMATION AND SCREENING DATA CLEARLY IDENTIFIES ACCEPTABLE PARTS.  PARTS ARE INSPECTED THROUGHOUT MANUFACTURE AND ASSEMBLY AS APPROPRIATE TO THE MANUFACTURING STAGE COMPLETED. THESE LOGGING, STRAPPING, ETC. OPERATIONS AND INSPECTION FOR CORRECT SOLDERING, WIRE LOGGING, STRAPPING, ETC. OPERATIONS AND INSPECTION TO CHECK FOR POROSITY AND INTERNAL FLAMS.  PRE AND POST POTITING INSPECTIONS TO SPAR-18P 257 VERIFY VOLTACE PROP (PERSISTANCE) AT MICH AND LOW TENDERATION (-30 DEGREES C AND *118 DEGREES C) (SPAR/GOVERNMENT REP. PANDATORY INSPECTION FOILT).  PUSCS ARE ACCEPTANCE TESTED TO SPAR-18P 257 VERIFY VOLTACE PROP (PERSISTANCE) AT MICH AND LOW TENDERATION (-30 DEGREES C AND *118 DEGREES C) (SPAR/GOVERNMENT REP. PANDATORY INSPECTION FOILT).  PRIOR TO DOTTING THIS PROPECTION OF PUSHED DACK CONTACTS OF THE

REPARED BY: MFMG SUPERCEDING DATE	E: 28 OCT 86	APPROVED BY:	DATE:
-----------------------------------	--------------	--------------	-------

CRITICAL ITEMS LIST

PROJECT: SRMS ASS'Y MOMENCLATURE: SHOULDEN

SYSTEM: MECHANICAL ARM SUBSYSTEM
ASS'Y P/N: 5114011219 SHEET: 4

DRAWING REF. FATLUME MODE FAILURE EFFECT REF. REV. AND 3/IRAB RATIONALE FOR ACCEPTANCE DESIGNATION CAUSE END ITEM CRITICALITY 4650 1 SHOULDER ONE OF FOUR 28V FUSING. 45 LOSS OF TV SUPPLY LINES A TEST READINESS REVIEW (TRR) WHICH INCLUDES VERIFICATION OF PRIME CAMERA PAN TEST PERSONNEL, TEST DOCUMENTS, TEST EQUIPMENT CALIBRATION/ VALIDATION STATUS AND MARDIANE CONFIGURATION IS CONVENED BY QUALITY ASSUMANCE IN COMMUNICION WITH ENGINEERING LOST. INCREASE CHAIMEL FUSES. 16 AND TILT IN VOLTAGE DROP FUSE. TO THE BACK-UP EQUIPMENT. NO RELIABILITY, CONFIGURATION CONTROL, SUPPLIER AS APPLICABLE, AND THE GOVERNMENT REPRESENTATIVE, PRIOR TO THE START OF ANY FORMAL TESTING (ACCEPTANCE OR QUALIFICATION). CHAINEL CAUSE(5): EFFECT WILL BE PUSES. MOTICED. VIRING NEĆNANICAL SCHEMATIC SHOCK MORST CASE JOINT LEVEL ACCEPTANCE TESTING (ATP) INCLUDES AMBINET, 51140E316 VIDRATION VIBRATION AND THERMAL -VAC TESTING. REVISION C. MATERIALS (FUSES 30 NO EFFECT ON (SPAR/GOVERNMENT REP. - MANDATORY INSPECTION POINT). CREW/VEHICLE OR THROUGH 411 MISSION. SRMS SYSTEMS INTEGRATION, THE INTEGRATION OF MECHANICAL ARM SUGASSEMBLIES AND THE FLIGHT CABIN EQUIPMENT TO FORM THE SRMS. REDUMDANT PATHS INSPECTIONS ARE PERFORMED AT EACH PHASE OF INTEGRATION WHICH INCLUDES GROUNDING CHECKS, THRU WIRING CHECKS, WIRING ROUTING, REMAINING INTERFACE CONNECTORS FOR BENT OR PUSH BACK CONTACTS ETC. J FUSES SRMS SYSTEMS TESTING . STRONGBACK AND FLAT FLOOR AMBIENT PERFORMANCE TEST. (SPAR/GOVERNMENT REP. - MANDATORY INSPECTION POINT)

RMS/MECH - 389

REF. RI	DRAWING REF. DESIGNATION	FATEURE NODE AND CAUSE	FATLURE EFFECT ON END ITEM	HDUR / FURC. 3/1RAB RATIONALE FOR ACCEPTANCE CRITICALITY
4650	SHOULDER FUSTING. 45 PRINE CHANNEL FUSES. 16 BACK-UP CHANNEL FUSES. WIRING SCHEMATIC 51140E316 REVISION C.	MODE: LOSS OF TV CAMERA PAM AND TILT FUSE.  CAMES(S): (1) NECRANICAL SHOCK VIDRATION MATERIALS (FUSES 38 THROUGH 41)	ONE OF FOUR 28V SUPPLY LINES LOST. INCREASE IN VOLTAGE DROP TO THE EQUIPMENT. NO EFFECT WILL BE NOTICED.  WORST CASE NO EFFECT ON CREM/VENICLE OR NISSION.  REDUNDANT PATHS REMAINING J FUSES	FAILURE HISTORY  THE FOLLOWING FAILURE ANALYSIS REPORT(S) ARE RELEVANT:  FAR 2114: S/N 202 JUL 80  DESCRIPTION  HIGH RESISTANCE FOLLOWING THERMAL CYCLING CAUSED BY NFG. DEFECT.  CORRECTIVE ACTION  NFG TO IMPLEMENT THERMAL TESTING. (FMEA NO. 4590, 4670)  FAR 2120: S/N 201 JAN 81  DESCRIPTION  HIGH RESISTANCE, MFG DEFECT. REFER TO FAR 2114. QUI-PUT DID NOT SWITCH, FOLLOWING HUMIDITY TEST, DUE TO SHORTED LED  CORRECTIVE ACTION  REFER TO FAR 2114 (FMEA NO.4590, 4670) REPLACED LED.  FAR 2358: S/N 302 NAY 83  DESCRIPTION  FUSE FAILED OPEN, CAUSED BY DAMAGED SOLDER CONN DURING REWORK.  CORRECTIVE ACTION  SCRAPPED REMORKED PUSES. ECN S1130 MODIFIED TESTING. (FMEA NO. 4590, 4670)  FAR 2370: S/N 304 NOV 83  DESCRIPTION  VOLTAGE DROP EXCESSIVE, CAUSE DESIGN/MANUFACTURING FAULT.  CORRECTIVE ACTION  SCRAPPED ALL FUSES, PREPARED NEW FUSE SPEC. (FMEA NO. 4590, 4670)

PREPARED BY: <u>HFWG</u>	SUPERCEDING DATE	: 28 OC1 86	APPROVED DY:	DATE:
--------------------------	------------------	-------------	--------------	-------

## CRITICAL ITEMS LIST

PROJECT: SRMS ASS'Y NOMENCEATURE: SHOULDER

SYSTEM: MECHANICAL ARM SUBSYSTEM
ASS'Y P/N: 51720J1219 SHEET: 6

4650 1	SHOULDER FUSING. 45 PRINE CHANNEL FUSES. 16 BACK-UP CHANNEL FUSES. WIRING SCHEMATIC 51140E316 REVISION C.	MODE: LOSS OF TV CAMERA PAN AND TILT FUSE.  CAUSE(S): (1) MECHANICAL SHOCK VIBRATION MATERIALS (FUSES 38 THROUGH 41)	ONE OF FOUR 28V SUPPLY LINES LOST. INCREASE IN VOLTAGE DROP TO THE EQUIPMENT. NO EFFECT WILL BE NOTICED.  WORST CASE NO EFFECT ON CREW/VEHICLE OR MISSION.  REDUNDANT PATHS REMAINING.  3 FUSES	OPERATIONAL EFFECTS  MONE WITH EACH SUBSEQUENT FAILURE A LEVEL OF REDUNDANCY IS LOST. WITH LOSS OF ALL PATHS THE CAMBERA CANNOT BE MOVED. THIS MAY RESULT IN THE CAMERA BEING CONFIGURED IN A PAYLOAD INTERFERENCE POSITION. IF LARGE PAYLOAD PRESENT IN BAY INTERFERENCE MAY CAUSE INABILITY TO STOW ARM.  CREW ACTION  EVA OR JETTISON ARM.  CREW TRAINING  MOME  MISSION CONSTRAINT  IF POSSIBLE INTERFERENCE, ELBOW CAMERA SHOULD ALWAYS BE RETURNED TO NOM INTERFERENCE POSITION IMMEDIATELY AFTER CAMERA OPERATIONS.  SCREEN FAILURES  A:PAN AND TELT OPERATES NORMALLY. INDEPENDENT PATHS NOT
				INSTRUMENTED.  8:PAN AND TELT OPERATES NORMALLY.INDEPENDENT PATHS NOT INSTRUMENTED.
l i				OHRSD OFFLINE VERIFY INDIVIDUAL FUSES PRIOR TO INSTALLATION OF PAN AND TILT UNIT.
				OMRSD ONLINE INSTALLATION
	(2) (2) (2) (3) (4) (4) (4) (4) (4) (4) (4) (4) (4) (4		ĺ	OMRSD ONLINE TURNAROUND

PREPARID BY: MING SUPERCEDING DATE: 28 OCT 86 APPROVED BY: